

## Parallel male straight adaptor - RPD MG



### BSP male thread

G 1/8

### For tube OD (mm)

4

### Operating pressure

0 to 10 bar

### Temperature

0°C to + 60°C


### Construction

Polymer and nickel-plated  
brass

## Description

Reference	BSP male thread	For tube OD (mm)
RPD MG0400	G 1/8	4
RPD MG0401	G 1/4	4
RPD MG0500	G 1/8	5
RPD MG0501	G 1/4	5
RPD MG0502	G 3/8	5
RPD MG0503	G 1/2	5

Reference	BSPB male thread	For tube OD (mm)
RPD MG0600	G 1/8	6
RPD MG0601	G 1/4	6
RPD MG0602	G 3/8	6
RPD MG0603	G 1/2	6
RPD MG0800	G 1/8	8
RPD MG0801	G 1/4	8
RPD MG0802	G 3/8	8
RPD MG0803	G 1/2	8
RPD MG1000	G 1/8	10
RPD MG1001	G 1/4	10
RPD MG1002	G 3/8	10
RPD MG1003	G 1/2	10
RPD MG1201	G 1/4	12
RPD MG1202	G 3/8	12
RPD MG1203	G 1/2	12
RPD MG1402	G 3/8	14
RPD MG1403	G 1/2	14
RPD MG1602	G 3/8	16
RPD MG1603	G 1/2	16

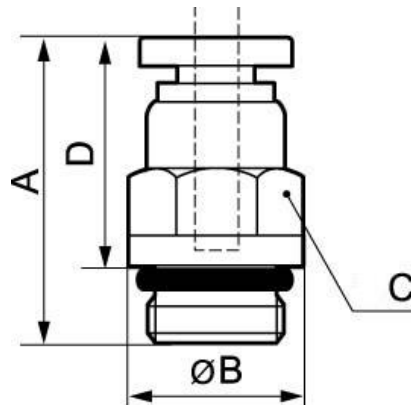

### Dimensions

Reference	A mm	B mm	C mm	D mm
RPD MG0400	20	14	12	14.5
RPD MG0401	19	16.5	14	13
RPD MG0500	24	14	12	18.5
RPD MG0501	21	16.5	14	15
RPD MG0502	21	20	17	14.5
RPD MG0503	22.5	22	19	14.5
RPD MG0600	24	14	12	18.5
RPD MG0601	21	16.5	14	15
RPD MG0602	21	20	17	20.5
RPD MG0603	22.5	22	19	14.5
RPD MG0800	25.5	16.5	14	20
RPD MG0801	22	16.5	14	16
RPD MG0802	21	20	17	14.5
RPD MG0803	22.5	22	19	14.5
RPD MG1000	27.8	20	17	22.3

Reference	A mm	B mm	C mm	D mm
<b>RPD MG1001</b>	27.8	20	17	21.8
<b>RPD MG1002</b>	25.8	22	19	19.3
<b>RPD MG1003</b>	26.3	25	21	18.3
<b>RPD MG1201</b>	30	22	19	24
<b>RPD MG1202</b>	26.5	22	19	20
<b>RPD MG1203</b>	28	25	21	20
<b>RPD MG1402</b>	30.8	25.5	22	24.3
<b>RPD MG1403</b>	28	28	24	20
<b>RPD MG1602</b>	33	28	24	26.5
<b>RPD MG1603</b>	34.5	28	24	26.5